



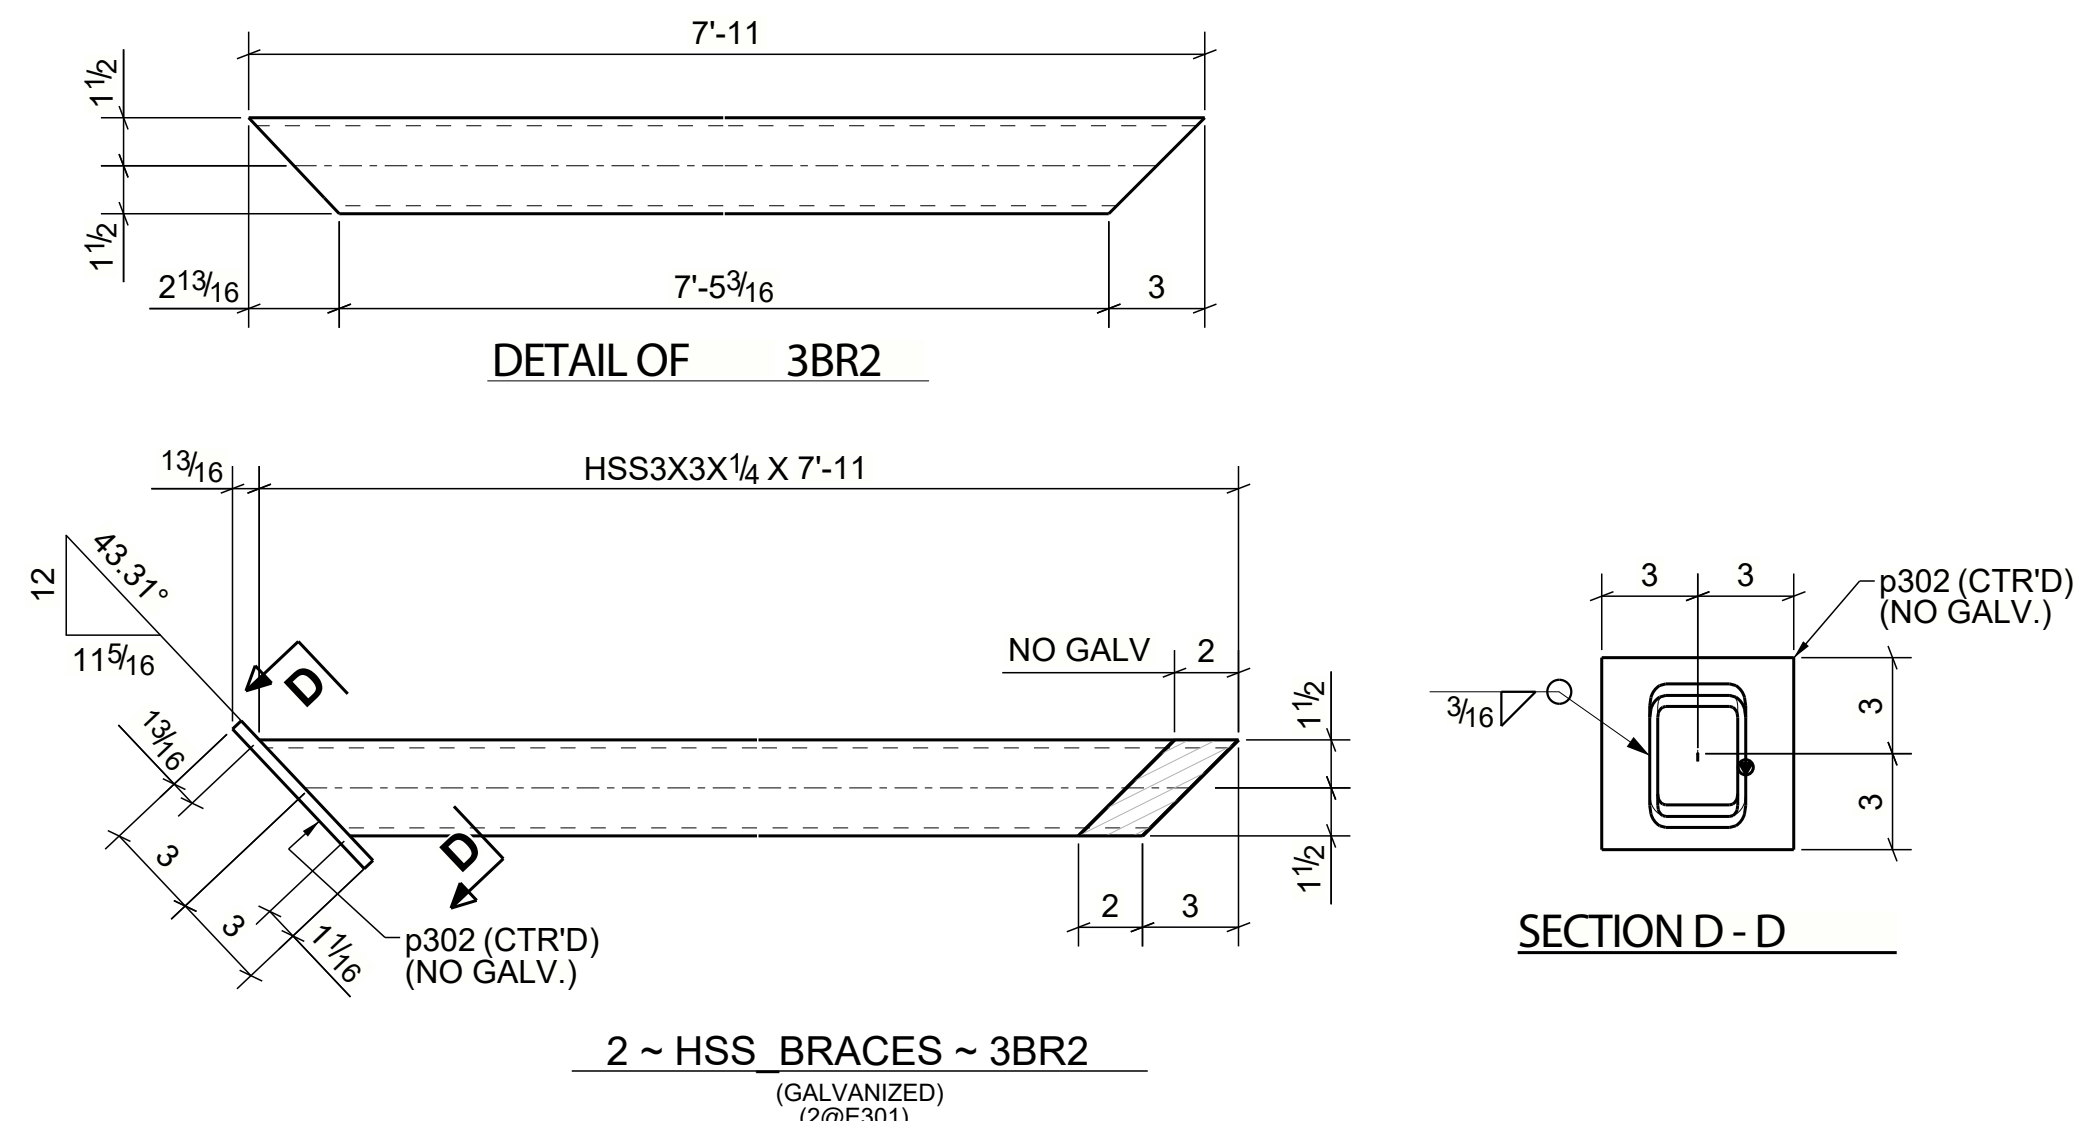

BILL OF MATERIAL						
SHIP MARK	PIECE MARK	QTY	DESCRIPTION	MATERIAL	LENGTH	REMARKS
3BR1		1	HSS_BRACE			(GALV)
	3BR1	1	HSS3X3X1/4	A500-GR.B	6'-5 7/8"	(GALV)
	p302	1	PL3/8"X6"	A36	0'-6"	
3BR2		2	HSS_BRACE			(GALV)
	3BR2	2	HSS3X3X1/4	A500-GR.B	7'-11"	(GALV)
	p302	2	PL3/8"X6"	A36	0'-6"	
3BR3		1	HSS_BRACE			(GALV)
	3BR3	1	HSS3X3X1/4	A500-GR.B	7'-5 1/16"	(GALV)
	p302	1	PL3/8"X6"	A36	0'-6"	
3BR4		1	HSS_BRACE			(GALV)
	3BR4	1	HSS3X3X1/4	A500-GR.B	6'-11 1/16"	(GALV)
	p302	1	PL3/8"X6"	A36	0'-6"	
3BR5		1	HSS_BRACE			(GALV)
	3BR5	1	HSS3X3X1/4	A500-GR.B	6'-7 11/16"	(GALV)
	p302	1	PL3/8"X6"	A36	0'-6"	

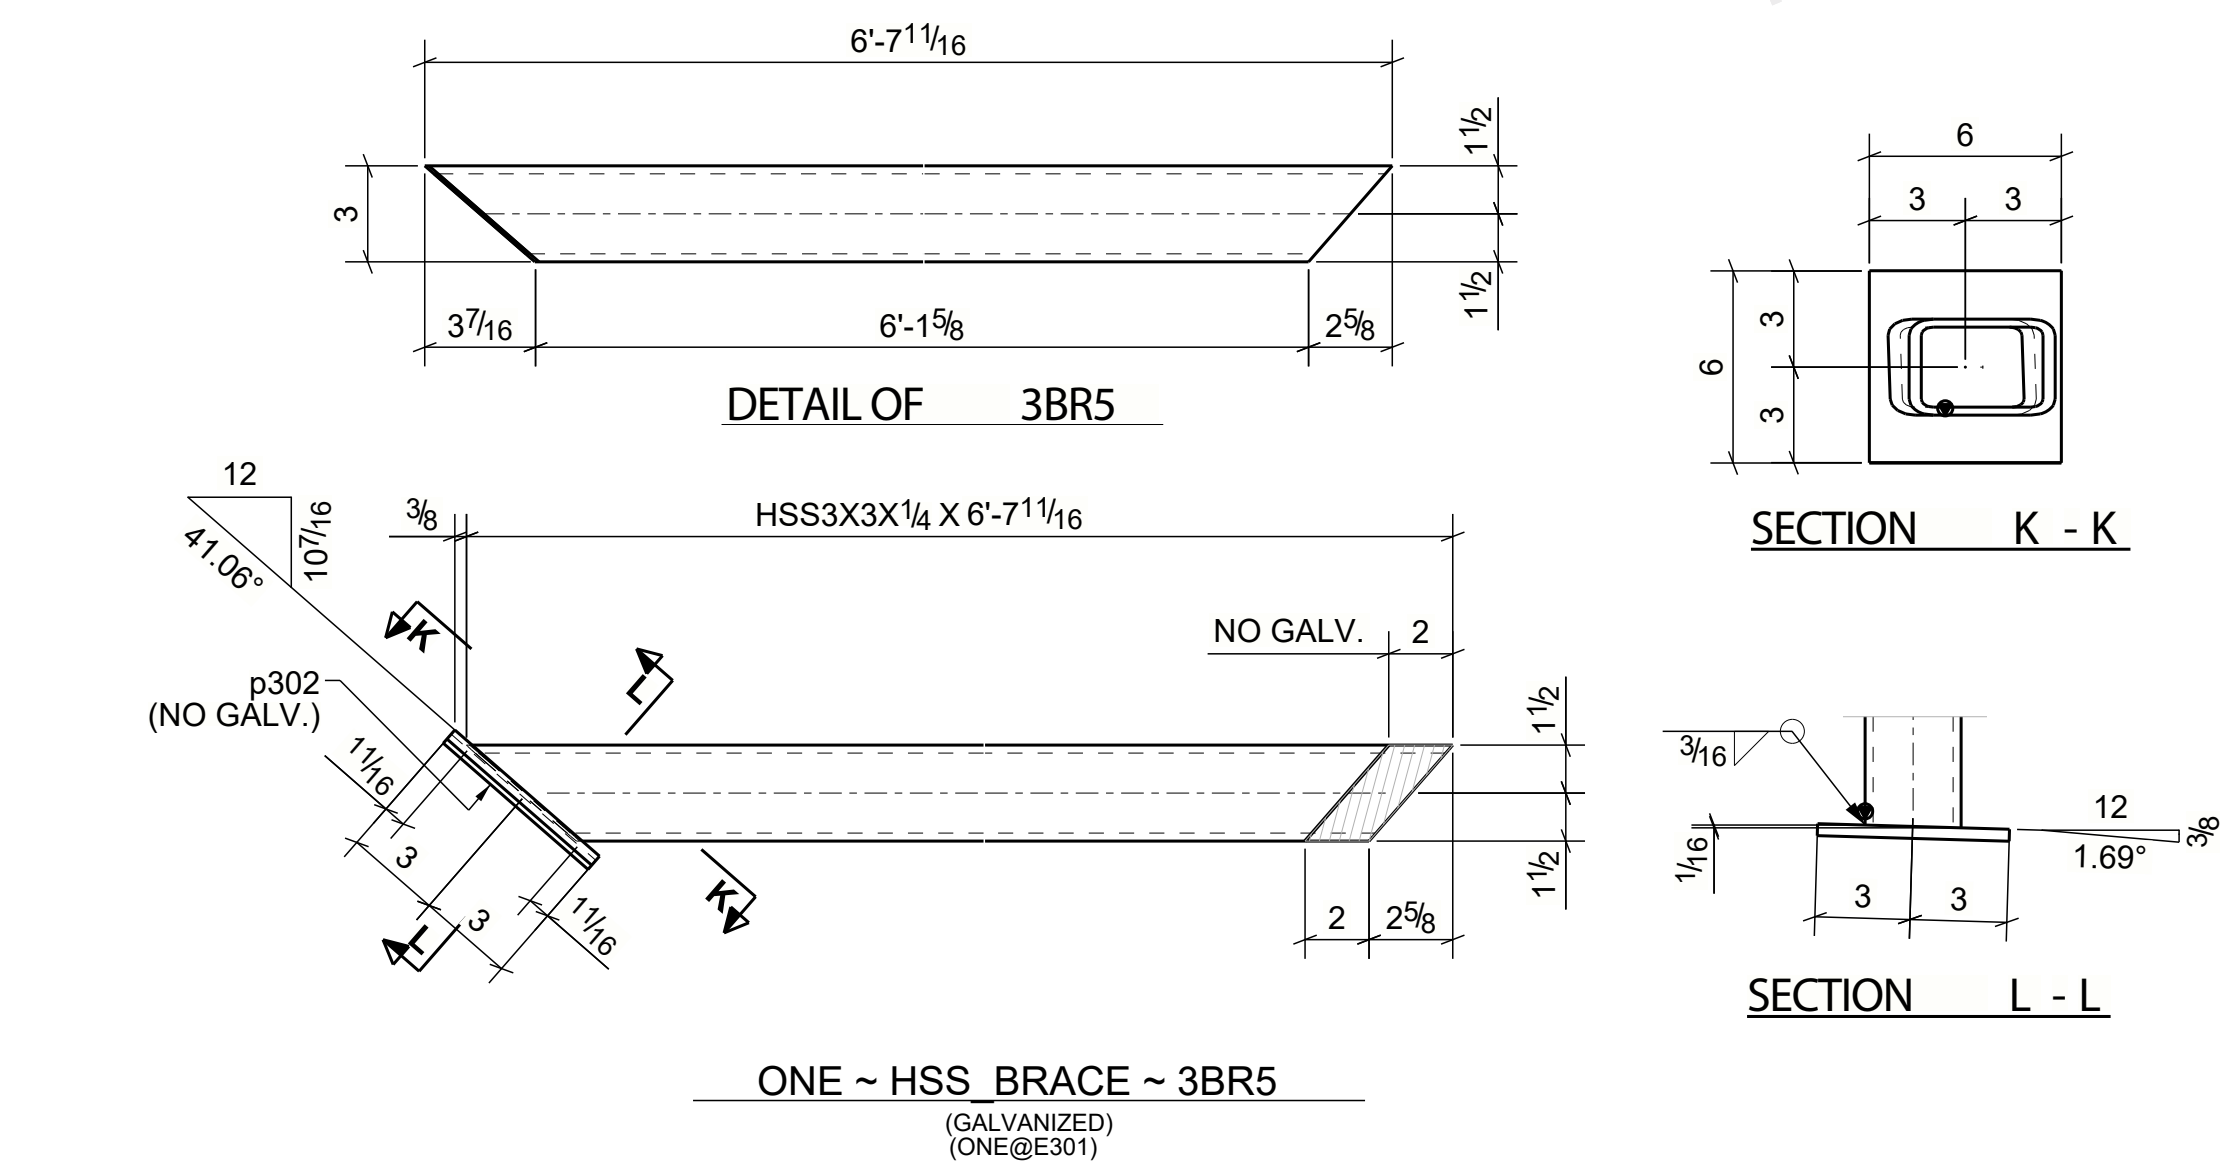

REVISIONS					
NO.	DATE	BY	DESCRIPTION		
▲	04/03/2023	AMP			For Approval

☒	FOR APPROVAL ONLY DO NOT FABRICATE	☐	FOR FABRICATION	☐	FOR FIELD
-------------------------------------	---------------------------------------	--------------------------	-----------------	--------------------------	-----------



STRUCTURE	ADVANCE AUTO PARTS
LOCATION	1005 WEST FLAGLER STREET MAIMI, FL 33130
CUSTOMER	STANSELL CONSTRUCTION
DETAIL OF	BRACES

HOLES	13/16 UNLESS NOTED	DRAWN BY	NIT	JOB NO.		SHEET NO.	
PAINT	GALVANIZED	CHECKED	AMP	3776		3	
		DATE:	03/27/2023				